

## STRAIN GAGE TYPE Extensometer

xtensometers measure strain, the change in length of a specimen divided by the original length (gauge length) of the specimen. An extensometer measures strain by means of knife edges which contact the sample. This series of extensometer comprises strain gaged devices

The models in this series of extensometer can be used to measure either longitudinal or transverse strain, or can be used in combination for determining 'r'-value and Poisson's ratio.

Key advantages of using strain gage type extensometers are as follows:


- Can be left on specimen through failure
- Lightweight to minimize any influence on the test
- Low operating force
- Rugged construction to withstand rigors of operation.





## **Key Features**

- Mechanical overtravel stops in both directions.
- Cable stops are used for overtravel where required. Cable stops are contained fully between the arms of the extensometer and do not hang below, where they can interfere with fixturing - especially during compression testing.
- Standard units meet existing ASTM class
  B-1 and ISO 9513, class 0,5 requirements for accuracy.
- Hardened tool steel knife edges are easily replaced. A spare set comes with every extensometer.
- Temperature options extend from as low as -265°c (-450°f) to +200°c (400°f)
- Includes high quality foam case.
- Replaceable arms and spacers for ease of repair.
  This also allows changing the gage length for different test requirements.
- Standard quick attach kit allows one hand mounting to specimens.

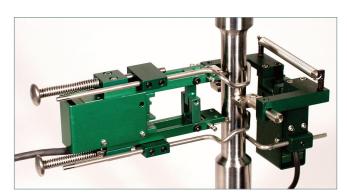



SG MODELS - ENGLISH UNITS				
Model	Measuring Range	Gage Length	Direction	
SG-20%-2	20%	2in	Longitudinal	
SG-20%-1.4	20%	1.4in	Longitudinal	
SG-20%-1	20%	1in	Longitudinal	
SG-20%-0.5	20%	0.5in	Longitudinal	
SG-50%-2	50%	2in	Longitudinal	
SGT-10%-1	+/- 0.1in	0 to 1in	Transverse	

SG MODELS - METRIC UNITS				
Model	Measuring Range	Gage Length	Direction	
SGM-20%-50	20%	50mm	Longitudinal	
SGM-20%-25	20%	25mm	Longitudinal	
SGM-20%-80	20%	80mm	Longitudinal	
SGM-50%-80	50%	80mm	Longitudinal	
SGM-50%-50	50%	50mm	Longitudinal	
SGM-100%-50	100%	50mm	Longitudinal	
SGMT-10%-25	+/-2.5mm	0 - 25mm	Transverse	





## STRAIN GAGE TYPE

Extensometer



- OHorsham, PA, USA Redhill, Surrey, UK
- ONoida, UP, India OShanghai, PR China